

**CONSERVATION RECORD DOCUMENT**  
Preventive Conservation / Conservation Works

**Samma Noble I & II, Makli**

**1. WORK PLAN**

Name of Work:  
Provision of Temporary Supports

Area	Struct. Name.	Struct. No.
Makli, Thatta WHS4	Samma Noble I & II	<b>1.08, 1.09</b>

**World Heritage Site at Makli, Thatta – WHS4  
Cluster 1, Samma Monuments**

Ref. Drg:  
**Under preparation**

**1.1 Description**

Placing of bamboo supports to all the leaning and or badly damaged brick walls in subject structures i.e. Tomb of Samma Noble I and II. The propping was carried out using about 4" diameter bamboo poles placed on lime stone base with about 4" diameter and 1 ½ " deep seat so that bamboos are not in direct contact with earth. Similarly, 4" x 6" and about an inch thick timber packing was placed between the top of the bamboo and the wall bricks. The locations were on all four sides of the Tomb of Samma Noble I and on South & West walls of Samma Noble 2 as seen in photographs below.

**1.2 Reason for Activity**

The activity was undertaken in pursuance of the decisions taken in the site meeting held on 5<sup>th</sup> March 2012 by Ar. Yasmeen Lari, and Engr. Mushtaq Dawood in order to provide temporary support to the most vulnerable parts. Engr. Mushtaq Dawood had recommended the propping up by providing bamboo supports since several parts of the structures were found to be in an extremely critical state and it was feared that they could collapse any time. The temporary propping up was essential until the documentation process was completed and strategies for conservation could be worked out.

**1.3 Time Frame**

Date of start:  
(Preparation)

Day	Month	Year
11	12	2012

Date of finish:  
(Installation)

Day	Month	Year
12	12	2012

**1.4 Workforce Requirement**

No.	No.	No.	No.
1	2	2	1
Supervisor	Skilled	Semi-skilled	Unskilled

**1.5 Estimated Cost**

To be calculated.

**1.6 Mechanism for recording material that may be removed**

Not applicable. No material was removed except samples of mortar for testing purposes.

**1.7 Methodology for identifying new works**




The placement of temporary supports was carried out according to locations identified by Engr. Mushtaq Dawood.

**1.8 Methodology for recording executed works**

Photographic recording was carried out during execution.

**1.9 Photographs Samma Noble I**

**1.10 Photographs Samma Noble II**

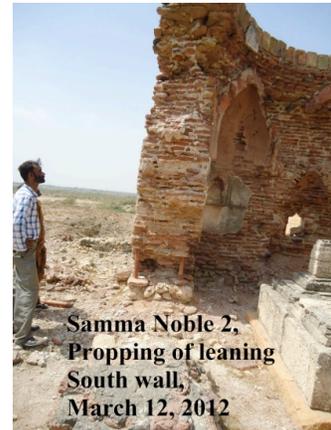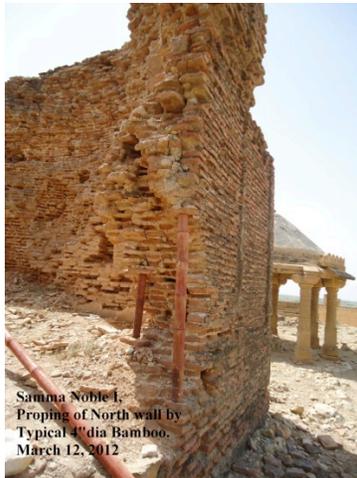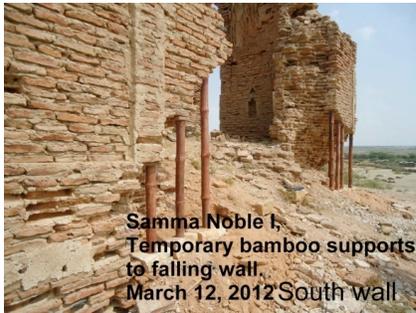

*Photographs by Engr. Mushtaq Dawood*

**1.11 Form prepared by**  
Ar. Yasmeen Lari

Date: 16 March, 2012

Designation

Hon. Project Director  
CEO Heritage Foundation

Signature

